

# Wunder-Bar™

Automatic Bar Controls Inc.

## TECHNICAL SERVICE BULLETIN (REVISED)


Date: 02/10/2020

Product: All Bar guns – Standard and Flow Regulated

Subject: Possible Leaking Heels Due to Stack Up Tolerance of Barrier Tubing

### Symptoms of potential fault:

When the barrier tubing is on the low end of the manufacturing tolerance, there is the potential for inadequate compression of the barrier tube cap into the Bar gun handle, which could result in a slow drip.

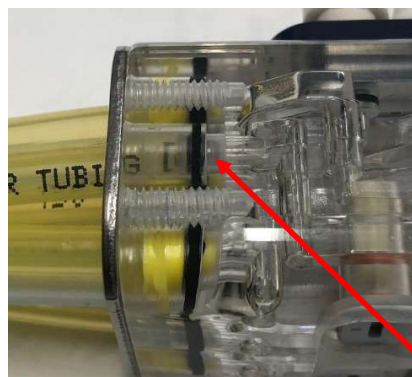

Area where a leak may occur

### Internal Corrective Action Taken:

Handles are now machined where the large barrier tubing holes are shallower in depth to allow for adequate compression where the large barrier tube cap and O-ring meet.

### Field Corrective Action:

Bar guns with a manufacturing date of 09/17/2019 and older that exhibit a leak should be submitted through the normal RMA process either directly with Wunder-Bar or the distributor you purchased your Bar guns from.

### Additional information:

Prior concerns to the yellow color change of the Cap – There were no changes to the material only a color additive.

If you need further details, please contact Wunder-Bar service at 1-866-986-3372 or [Service@wunderbar.com](mailto:Service@wunderbar.com)